


STRONG

PLATINUM ENGINE LOG BOOK

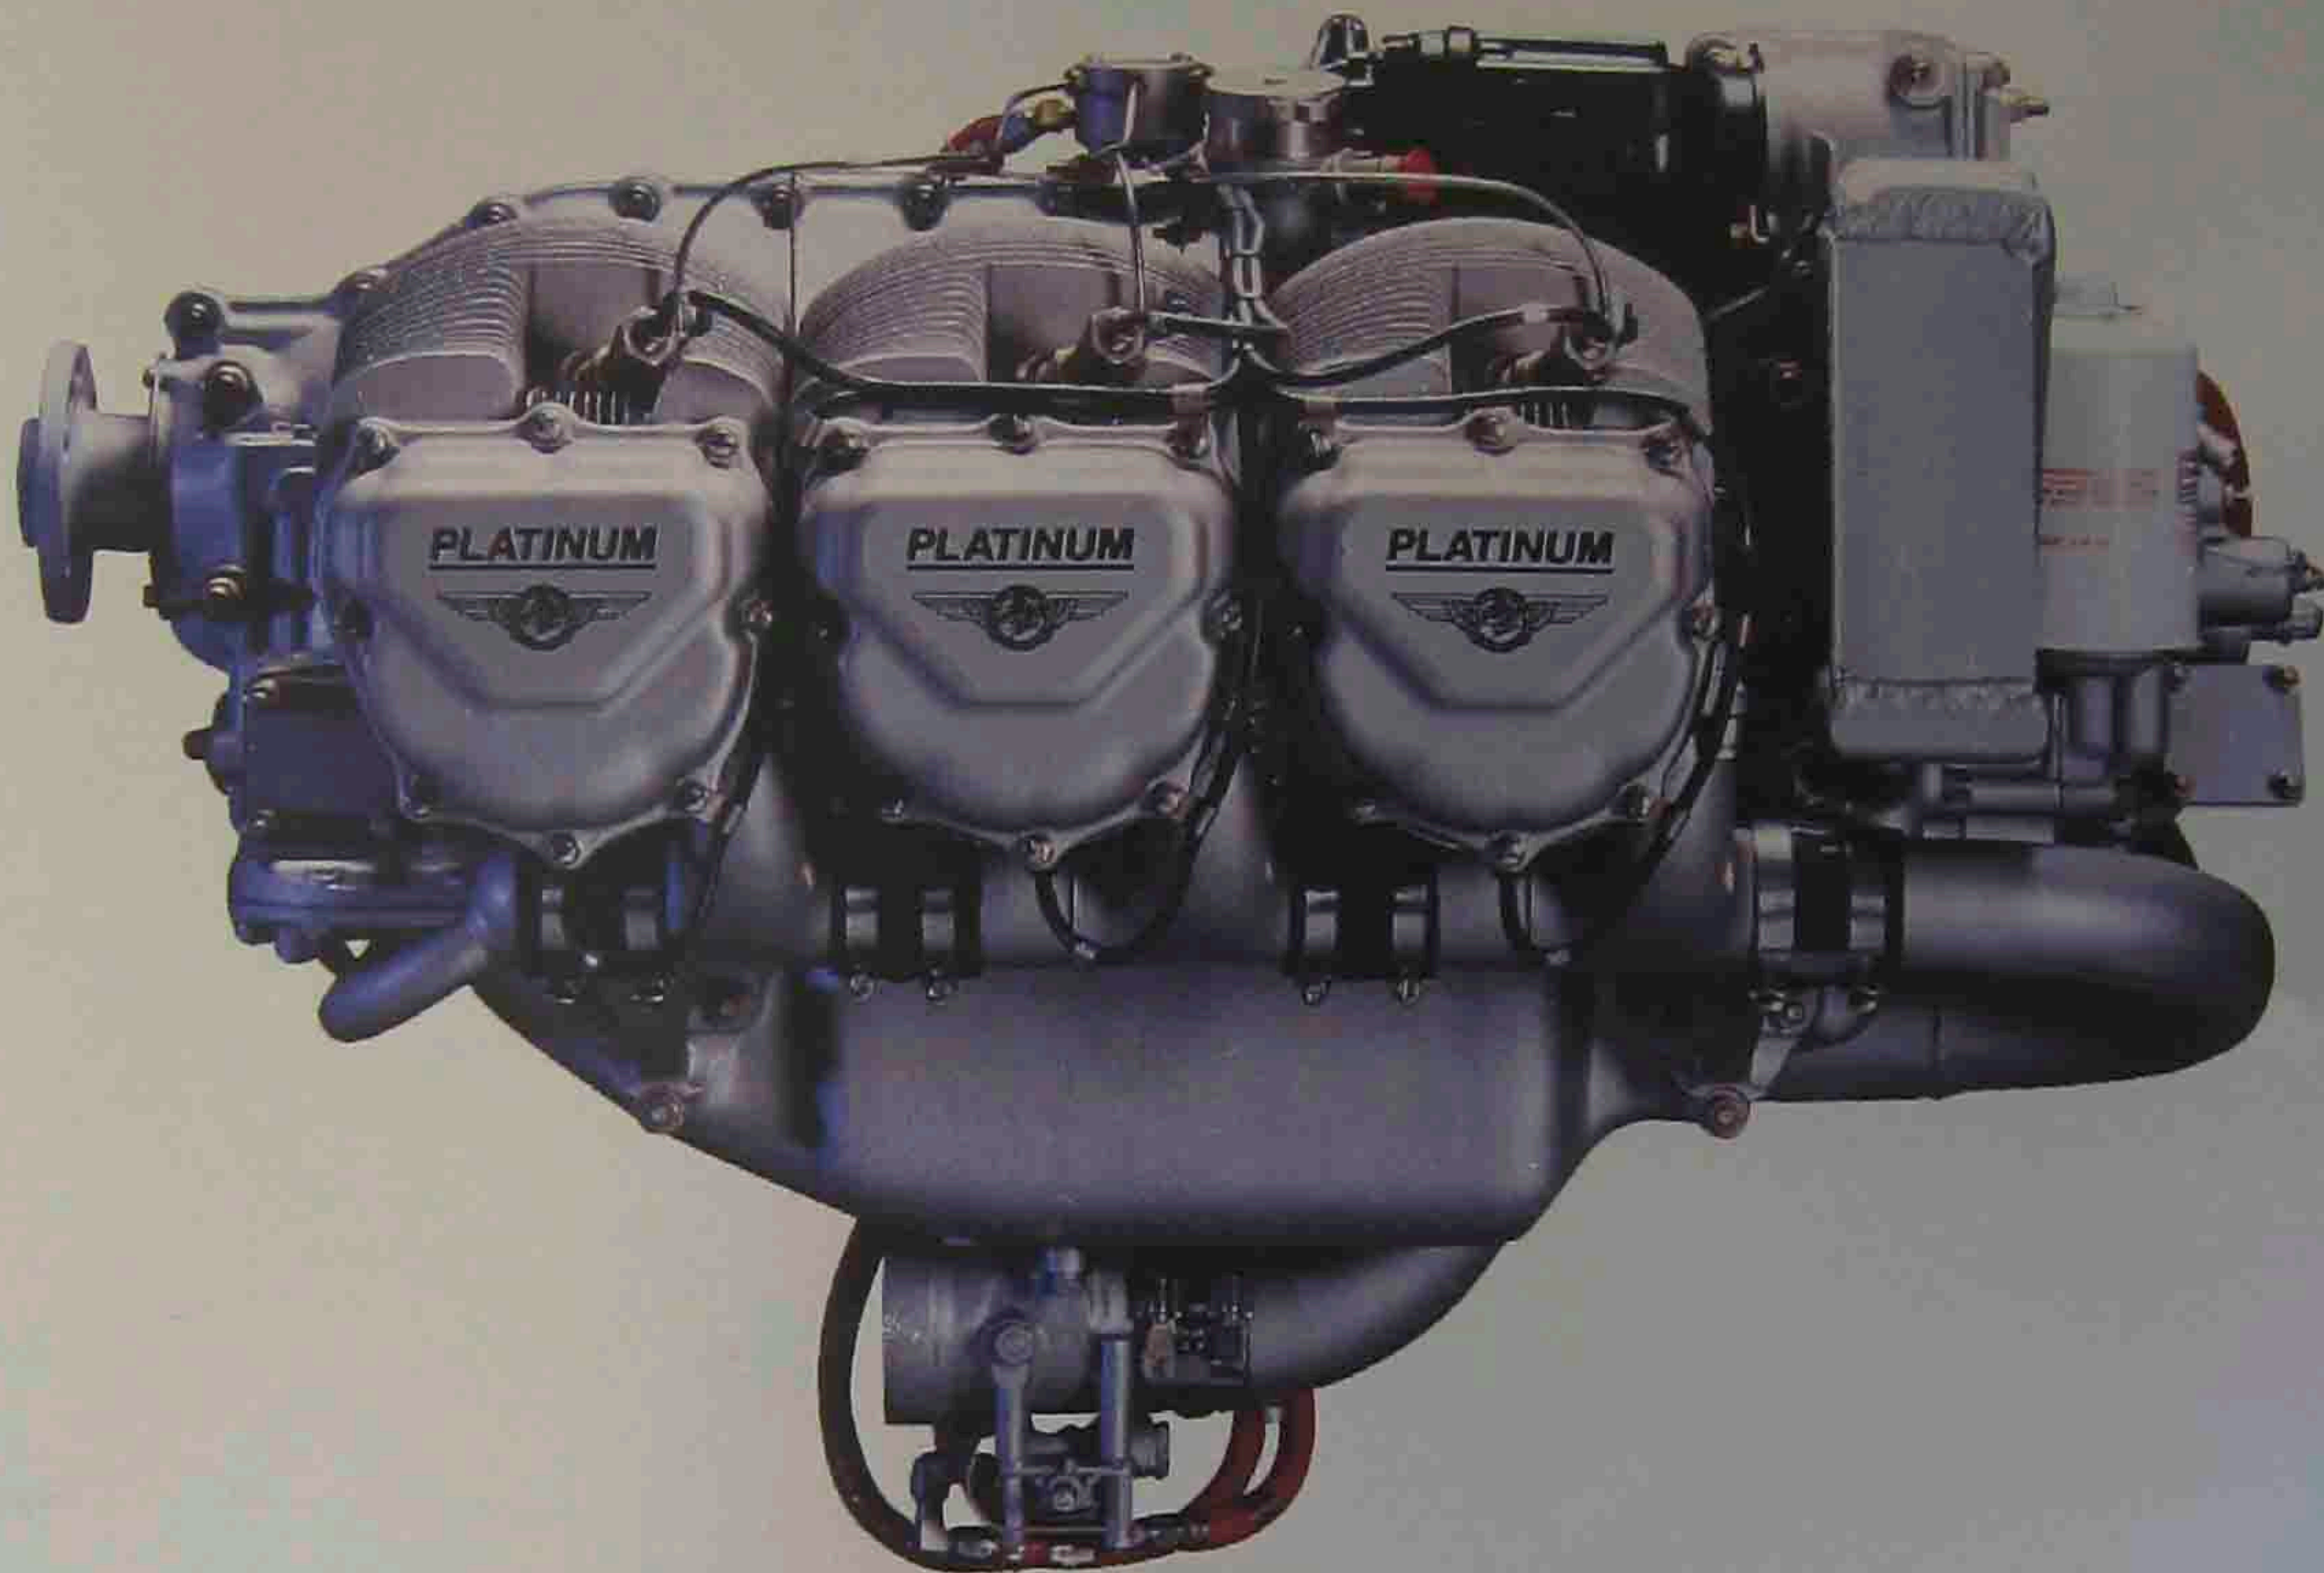

CONTINENTAL MOTORS

Last Overhaul	
Hrs.	Min.
Hrs.	Min.

Brought Forward →

BMG Aviation Inc. 812-825-7979 Date: 03/27/08
 984 South Kirby Road Bloomington, IN 47403

N72ET
 Hobbs : 71.1

1. Remove cowling, drain oil, remove & inspect filter.
2. Installed 7 qts Aero shell 100W Plus.
3. Install new CH48108-1 filter.
4. C/W SA08-03/ TAT SB 08-01 Exhaust elbow
5. Test run A/C & check for leaks. No leaks noted.
6. Return A/C to service.

End

Signature Bob Burke Bob Burke AP3146370

BMG Aviation Inc. 812-825-7979 Date: 06/24/08
 984 South Kirby Road Bloomington, IN 47403

N72ET
 Airframe Hobbs : 115 Engine Hobbs: 85

1. Remove cowling,
2. Removed, cleaned, gapped, rotated & reinstalled plugs.
3. Inspect engine, mounts, firewall, & exhaust.
4. Pressure test exhaust & turbo system for leaks
5. Replace turbo support bolts, upper brackets, springs, and mounting hardware left & right and aligned IAW Tornado Alley Instructions
6. Inspect fuel system & clean injectors
7. Compression #1-72, #2-77, #3-77, #4-78, #5-79, #6-77
8. Wash down engine, test run no leaks noted.

I certify that this engine has been inspected in accordance with FAR 43 appendix "D" 100 Hour inspection and was determined to be in airworthy condition. Signed: Bob Burke Bob Burke 3146370AP

BMG Aviation Inc. 812-825-7979 Date: 09/22/08
 984 South Kirby Road Bloomington, IN 47403

N72ET
 Hobbs #1: 135.1 Hobbs #2: 98.3

1. Remove cowling, drain oil, remove & inspect filter.
2. Installed 7 qts Aero shell 100W Plus.
3. Install new CH48108-1 filter.
4. C/W Kelly Aerospace SL A-131 Turbo ID plates
5. Replace actuator rod to waste gate clevis pin right turbo.
5. Test run A/C & check for leaks. No leaks noted.
6. Return A/C to service.

End

Signature Bob Burke Bob Burke AP3146370

